



707, 727-787

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF CONNECTORS WITH SOLDER TYPE CONTACTS

<u>Paragraph</u>	<u>Page</u>
1. <u>GENERAL DATA</u>	1
A. Applicable Conditions	1
B. Minimum Wire O.D. for an Environmentally Sealed Connector	1
2. <u>PART NUMBERS AND DESCRIPTION</u>	1
A. Connector Part Numbers	1
B. Solder Adapter Part Numbers	2
3. <u>CONTACT ASSEMBLY</u>	2
A. Installation of One Wire in a Contact Solder Cup	2
B. Installation of More Than One Wire in a Contact Solder Cup	3

20-40-00 CONTENTS

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF CONNECTORS WITH SOLDER TYPE CONTACTS

1. GENERAL DATA

A. Applicable Conditions

CAUTION: DO NOT APPLY MORE THAN THE NECESSARY AMOUNT OF HEAT. DAMAGE TO THE CONNECTOR OR THE WIRE CAN OCCUR

CAUTION: DO NOT LET THE STRANDS OF THE CONDUCTOR THAT ARE IN THE INSULATION OF THE WIRE ABSORB THE SOLDER. THE WIRE:

- CANNOT BEND AT THE NECESSARY LOCATION
- CAN BREAK AT THE END OF THE SOLDER.

B. Minimum Wire O.D. for an Environmentally Sealed Connector

Refer to:

- Subject 20-60-08 for the identification of an environmentally sealed connector
- Table 1 for the minimum wire O.D. that is necessary for a satisfactory seal of a contact cavity hole
- Subject 20-60-08 for the procedure to increase the diameter of the wire.

Table 1
MINIMUM WIRE O.D. FOR A SATISFACTORY SEAL

Connector	Description	Contact Cavity Size	Minimum Wire O.D. (inch)
PT06E()	MIL-C-26482 series I type; front release, rear removal solder contacts	20	0.060
		16	0.066
		12	0.097
SM3106()	MIL-C-5015 type, front release, rear removal solder contacts	16	0.064
		12	0.114
		8	0.164
		4	0.272
		0	0.415

2. PART NUMBERS AND DESCRIPTION

A. Connector Part Numbers

Table 2
CONNECTOR PART NUMBERS

Part Number	Description	Supplier
CE9307-()	Rack and Panel Plug Connector	ITT Cannon
DPDN10-33S1B	Rack and Panel Plug Connector	ITT Cannon
DPDB18-33S1B	Rack and Panel Plug Connector	ITT Cannon
DPE60-33S	Plug Connector	ITT Cannon
DPXF40C1S	Rack and Panel Plug Connector	ITT Cannon

20-40-00

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF CONNECTORS WITH SOLDER TYPE CONTACTS

Table 2 (continued)

Part Number	Description	Supplier
KO()	High Density Circular Plug Connector	ITT Cannon
PT06E()	Circular Plug Connector	Amphenol
SM3106()	Circular Plug Connector	Bendix
SRPA1N8AS1	Sliding Rack Plug Connector	Bendix
VB10-1PWC11-76	Relay Socket	Viking

B. Solder Adapter Part Numbers

Table 3
SOLDER ADAPTER PART NUMBERS

Boeing Standard	Part Number	Supplier
BACA14AB164	460-3094-01-01-00	Cambion

3. CONTACT ASSEMBLY

A. Installation of One Wire in a Contact Solder Cup

- (1) If a solder adapter is specified, make a selection of a solder adapter from Table 3.
- (2) If the connector does not have a grommet, put a 0.75 inch \pm 0.13 inch length of MIL-DTL-23053/5 Class 1 heat shrinkable sleeve on the wire.
Make sure that the sleeve has the smallest possible diameter that can be put on the wire.
NOTE: For alternative equivalent heat shrinkable sleeves, refer to Subject 20-00-11.
- (3) Remove the necessary length of insulation from the end of the wire.
NOTE: When the wire is fully installed in the contact, the end of the insulation must not be more than 0.06 inch from the rear end of the solder cup.
- (4) If a solder adapter is specified:
 - (a) Tin these components of the contact assembly:
 - The wire
 - The solder adapter
 - The contact solder cup.
 - (b) Solder the end of the wire in the adapter.
 - (c) Solder the adapter in the solder cup.
- (5) If a solder adapter is not specified:
 - (a) Tin these components of the contact assembly:
 - The wire
 - The contact solder cup.
 - (b) Solder the end of the wire in the solder cup.
- (6) If the connector has a grommet and the contacts can be removed:

20-40-00

STANDARD WIRING PRACTICES MANUAL**ASSEMBLY OF CONNECTORS WITH SOLDER TYPE CONTACTS**

- (a) Measure the O.D. of the wire.
- (b) If the O.D. of the wire is less than the minimum seal diameter of the connector grommet hole, increase the O.D. of the wire. Refer to Paragraph 1.B.
- (7) If the connector does not have a grommet:
 - (a) Push the heat shrinkable sleeve forward until the forward end of the sleeve is between 0 inch and 0.06 inch from the rear face of the connector.
 - (b) Shrink the sleeve into its position. Refer to Subject 20-10-14.

B. Installation of More Than One Wire in a Contact Solder Cup

This paragraph gives the procedure to solder two or three AWG 22 wires in an size 20 contact with a solder cup.

- (1) Make a selection of a solder adapter from Table 3.
- (2) If the connector does not have a grommet, put a 0.75 inch \pm 0.13 inch length of MIL-DTL-23053/5 Class 1 heat shrinkable sleeve on the wire.

Make sure that the sleeve has the smallest possible diameter that can be put on the wire.

NOTE: For alternative equivalent heat shrinkable sleeves, refer to Subject 20-00-11.

- (3) Remove the necessary length of insulation from the end of the wire.

NOTE: When the wire is fully installed in the contact, the end of the insulation must not be more than 0.06 inch from the rear end of the solder cup.

- (4) Tin these components of the contact cavity:
 - The wire
 - The solder adapter
 - The contact solder cup.
- (5) Solder the end of the wire in the adapter.
- (6) Solder the adapter in the solder cup.
- (7) If the connector does not have a grommet:
 - (a) Push the heat shrinkable sleeve forward until the forward end of the sleeve is between 0 inch and 0.06 inch from the rear face of the connector.
 - (b) Shrink the sleeve into its position. Refer to Subject 20-10-14.



707, 727-787

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE GRIMES-HONEYWELL A-4135 MAP LIGHT

Paragraph

Page

1. ASSEMBLY OF THE GRIMES-HONEYWELL A-4135 MAP LIGHT

1

For training purposes only!

20-40-12 CONTENTS

D6-54446

Page 1
Oct 01/2010



707, 727-787

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE GRIMES-HONEYWELL A-4135 MAP LIGHT

1. ASSEMBLY OF THE GRIMES-HONEYWELL A-4135 MAP LIGHT

This Subject is now located in Subject 20-84-11.

For training purposes only!

20-40-12

Page 1
Oct 01/2010

D6-54446



707, 727-787

STANDARD WIRING PRACTICES MANUAL

TERMINATION OF WIRE IN MS25257 TYPE INDICATOR LIGHTS

Paragraph

Page

1. TERMINATION OF WIRE IN MS25257 TYPE INDICATOR LIGHTS

1

For training purposes only!

20-40-13 CONTENTS



707, 727-787

STANDARD WIRING PRACTICES MANUAL

TERMINATION OF WIRE IN MS25257 TYPE INDICATOR LIGHTS

1. TERMINATION OF WIRE IN MS25257 TYPE INDICATOR LIGHTS

This Subject is now located in Subject 20-84-19.

For training purposes only!

20-40-13

Page 1
Feb 01/2011

D6-54446



707, 727-787

STANDARD WIRING PRACTICES MANUAL

TERMINATION OF WIRE IN THE JOHNSON 105-0303-001 TIP PLUG CONNECTOR

<u>Paragraph</u>	<u>Page</u>
1. <u>WIRE TERMINATION</u>	1
A. Wire Preparation	1
B. Installation of the Wire	1

For training purposes only!

20-40-14 CONTENTS

Page 1
Jun 01/2009

D6-54446

STANDARD WIRING PRACTICES MANUAL**TERMINATION OF WIRE IN THE JOHNSON 105-0303-001 TIP PLUG CONNECTOR**

This Subject gives the procedure to attach BMS 13-48 AWG 22 wire to the tip plug connector.

1. WIRE TERMINATION**A. Wire Preparation**

- (1) Remove 1/4 inch \pm 1/16 inch of insulation from the end of the wire.
- (2) Tin the bare conductor strands.
- (3) Put the insulated handle on the wire.
- (4) Make a selection of these Grade B, Class 1 heat shrinkable sleeves from Subject 20-00-11:
 - 1/16 inch diameter sleeve
 - 3/16 inch diameter sleeve.
- (5) Put the heat shrinkable sleeves on the wire:
 - Two 1 inch lengths of 1/16 inch diameter sleeve
 - One 1 inch length of 3/16 inch diameter sleeve.

B. Installation of the Wire

- (1) Tin the area around the wire exit hole on the side of the pin body.
- (2) Put the sufficient amount of Kester 197 flux or an equivalent flux on the tinned area.
- (3) Put the end of the wire into the wire entry hole so that 1/8 inch to 3/16 inch of the wire is on the other side of the hole.
- (4) Solder the wire in the tip plug.
- (5) Install each heat shrinkable sleeve:
 - (a) Push the sleeve until the end of the sleeve is against the rear of the plug.
 - (b) Shrink the sleeve in position. Refer to Subject 20-10-14.
- (6) Engage the threads of the insulated handle and the body of the tip plug.
- (7) Tighten the handle.

20-40-14



707, 727-787

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE ITT GREMAR 150900-() TWINAXPLUG CONNECTOR

<u>Paragraph</u>	<u>Page</u>
1. <u>PART NUMBERS AND DESCRIPTION</u>	1
A. Connector Part Numbers	1
B. Connector Description	1
2. <u>CONNECTOR DISASSEMBLY</u>	2
A. Separation of the Plug from the Receptacle	2
B. Contact Disassembly	2
C. Connector Disassembly	3
3. <u>CONNECTOR ASSEMBLY WITH RG108/U OR RAYCHEM 10599 TWINAX CABLE</u>	3
A. Cable Preparation	3
B. Contact Assembly	6
C. Connector Assembly	6
4. <u>CONNECTOR INSTALLATION</u>	7
A. Installation of a Plug into a Receptacle	7

20-40-15 CONTENTS

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE ITT GREMAR 150900-() TWINAXPLUG CONNECTOR

This Subject gives these procedures for the twinax plug connectors:

- Separation
- Disassembly
- Assembly
- Installation.

1. PART NUMBERS AND DESCRIPTION

A. Connector Part Numbers

Table 1
TWINAX PLUG CONNECTOR PART NUMBERS

Part Number	Contact Type	Clamp Configuration	Supplier
150900-0302	Socket	Shield clamp only	ITT Gremar
150900-0303	Pin	Shield clamp only	ITT Gremar
150900-2341	Socket	Shield clamp and jacket clamp	ITT Gremar
150900-2342	Pin	No clamps; does not accept a shield	ITT Gremar
150900-2343	Socket	No clamps; does not accept a shield	ITT Gremar
204-18291-2	Pin	Shield clamp only	Boeing


NOTE: Some Wiring Diagrams show the Boeing 204-18291-2 plug as an alternative to the 150900-0303 twinax plug.

B. Connector Description

The twinax plug connector has these technical features:

- Solder cup contacts
- Integral shield to connector shell electrical bond.


Refer to Figure 1 and Figure 2.

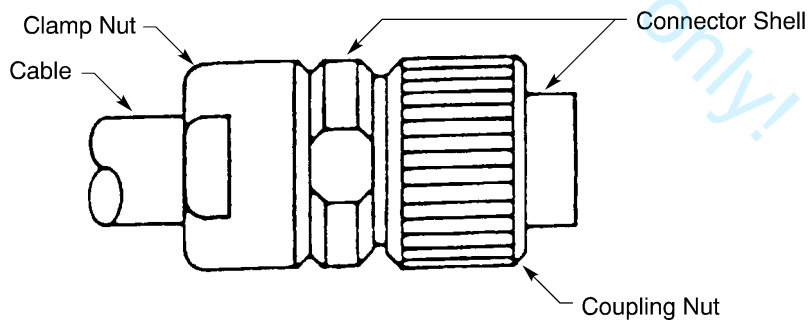

THE ITT GREMAR 150900-() TWINAX PLUG CONNECTOR ASSEMBLY
Figure 1

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE ITT GREMAR 150900-() TWINAXPLUG CONNECTOR

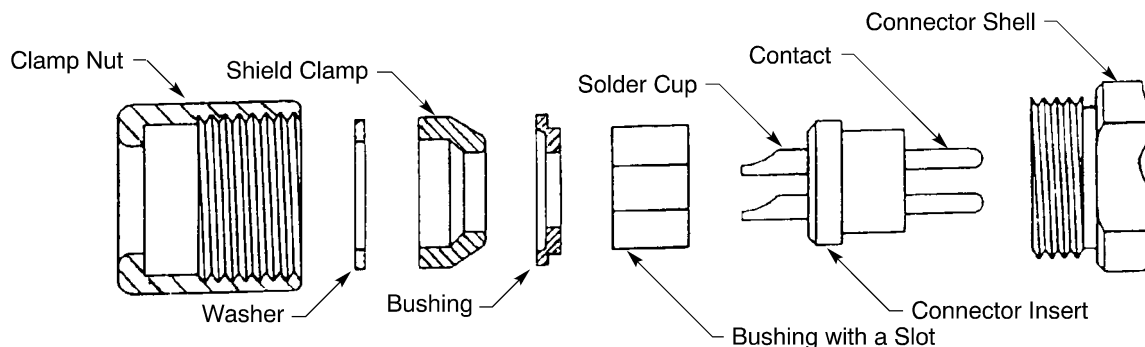

COMPONENTS OF THE ITT GREMAR 150900-() TWINAX PLUG

Figure 2


2. CONNECTOR DISASSEMBLY

A. Separation of the Plug from the Receptacle

- (1) Turn the coupling nut until the threads are disengaged from the threads on the receptacle receptacle. Refer to Figure 1.
- (2) Pull the shell of the plug away from the receptacle.
Make sure that the shell stays perpendicular to the receptacle.

CAUTION: DO NOT PULL THE CABLE TO DISCONNECT THE PLUG FROM THE RECEPTACLE. IT CAN CAUSE DAMAGE TO THE CABLE.

B. Contact Disassembly

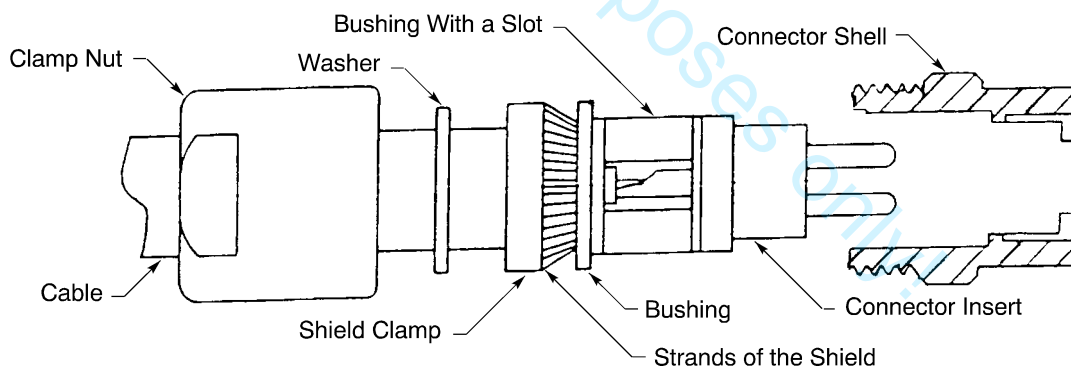

CONTACT DISASSEMBLY

Figure 3

Refer to Figure 3.

- (1) Disengage the threads of the clamp nut from the threads of the connector shell.
- (2) Move the nut and the washer away from the connector.
- (3) From the forward end of the connector, carefully push the connector insert out of the connector shell.
- (4) Remove the bushing with a slot.
- (5) For each contact:


20-40-15

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE ITT GREMAR 150900-() TWINAXPLUG CONNECTOR

- (a) Apply heat to the solder cup of the contact with a soldering iron.
- (b) Remove the conductor from the contact.

C. Connector Disassembly

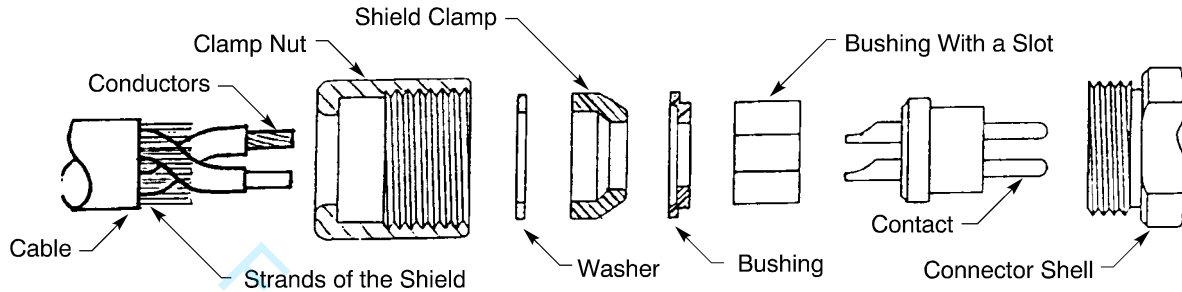

CONNECTOR DISASSEMBLY
Figure 4

Refer to Figure 4.


- (1) Remove the bushing from the cable.
- (2) Push the strands of the shield against the conductors.
Make sure that the strands are flat against the outer jacket of the cable.
- (3) In this order, carefully remove these components from the cable:
 - The shield clamp
 - The washer
 - The clamp nut.

3. CONNECTOR ASSEMBLY WITH RG108/U OR RAYCHEM 10599 TWINAX CABLE

A. Cable Preparation

- (1) In order, put these components on the end of the cable:
 - The clamp nut
 - The washer.

Refer to Figure 5.

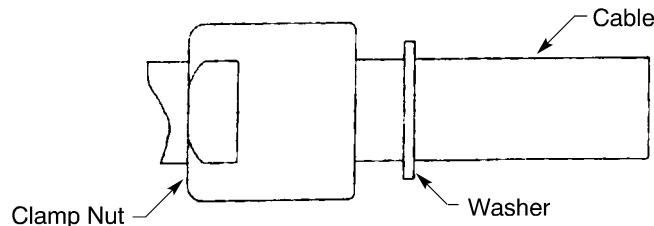

POSITION OF THE CLAMP NUT AND THE WASHER ON THE CABLE
Figure 5


- (2) Remove 0.30 inch \pm 0.03 inch of the outer jacket from the end of the cable. Refer to Subject 20-00-15 and Figure 6.

20-40-15

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE ITT GREMAR 150900-() TWINAXPLUG CONNECTOR


- (3) Remove 0.20 inch \pm 0.02 inch of the shield from the end of the cable. Refer to Figure 6.

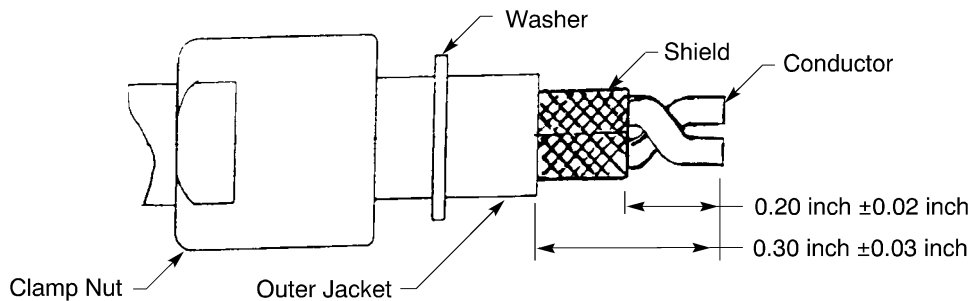

OUTER JACKET AND SHIELD REMOVAL

Figure 6


- (4) Remove 0.13 inch \pm 0.02 inch of the insulation from each conductor. Refer to Figure 7.

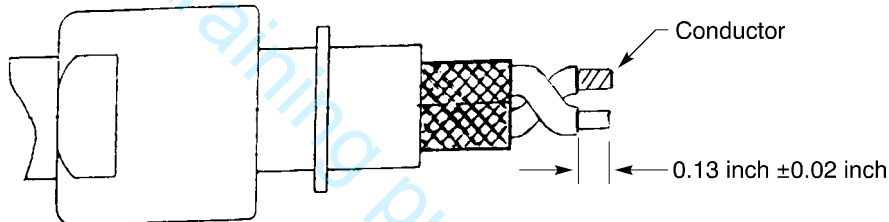

INSULATION REMOVAL

Figure 7

- (5) For the Raychem 10599 cable, the outer diameter of the cable must be increased so that the clamp nut has the correct fit. Refer to Figure 8.

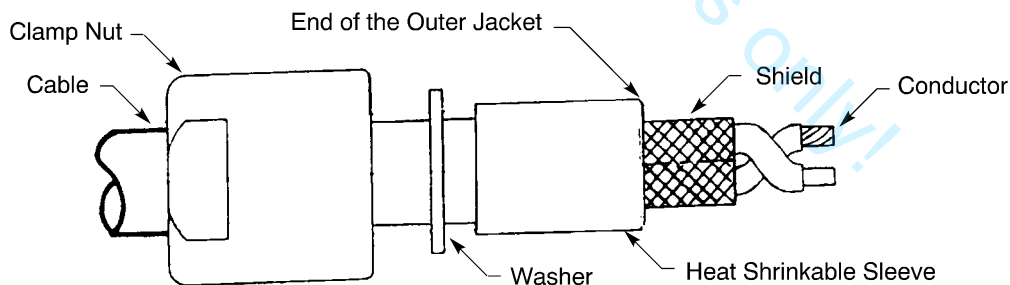


POSITION OF THE HEAT SHRINKABLE SLEEVES

Figure 8

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE ITT GREMAR 150900-() TWINAXPLUG CONNECTOR

- (a) Make a selection of these Grade B, Class 1 heat shrinkable sleeves from Subject 20-00-11:
 - 0.19 inch diameter sleeve
 - 0.25 inch diameter sleeve.
- (b) Cut these lengths of the heat shrinkable sleeve:
 - Two 1.0 inch \pm 0.1 inch lengths of the 0.19 inch diameter sleeve
 - Two 1.0 inch \pm 0.1 inch lengths of the 0.25 inch diameter sleeve.
- (c) Put one of the sleeves that has the smaller diameter on the cable.
Make sure that the end of the sleeve is aligned with the end of the outer jacket.
- (d) Shrink the sleeve into its position. Refer to Subject 20-10-15.
- (e) Put the other sleeve that has the smaller diameter on the cable.
Make sure that the end of the sleeve is aligned with the end of the outer jacket.
- (f) Shrink the sleeve into its position. Refer to Subject 20-10-15.
- (g) Do Step (c) through Step (f) again for the sleeves that have the larger diameter.
- (6) Move the strands of the shield apart with a plastic awl or an equivalent tool.
- (7) Push the shield against the conductors.
Make sure that the strands are flat against the cable jacket.
- (8) Put the shield clamp on the cable.
Make sure that the clamp is:
 - On the strands of the shield
 - Against the end of the outer jacket of the cable.
- (9) Fold the strands of the shield on the front end of the clamp.
Make sure that the strands are:
 - Even and symmetrical around the clamp
 - Flat against the clamp
 - The strands of the shield go on the edge of the clamp.
- (10) Put the bushing on cable.
Make sure that the bushing holds the strands of the shield against the shield clamp. Refer to Figure 9.

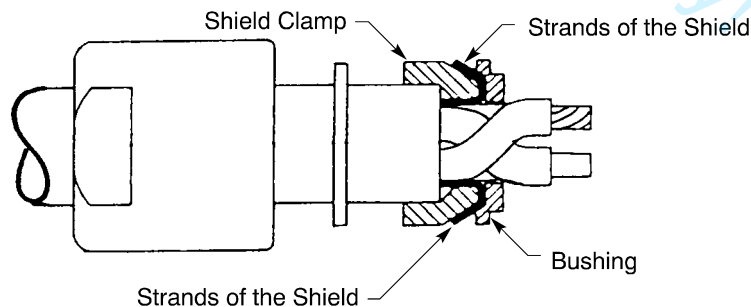

POSITION OF THE BUSHING, THE STRANDS OF THE SHIELD, AND THE SHIELD CLAMP

Figure 9

20-40-15


STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE ITT GREMAR 150900-() TWINAXPLUG CONNECTOR

B. Contact Assembly

NOTE: The conductor that:

- Has tin coated strands is identified as White by the Wiring Diagram
- Is solid copper is identified as Blue by the Wiring Diagram.

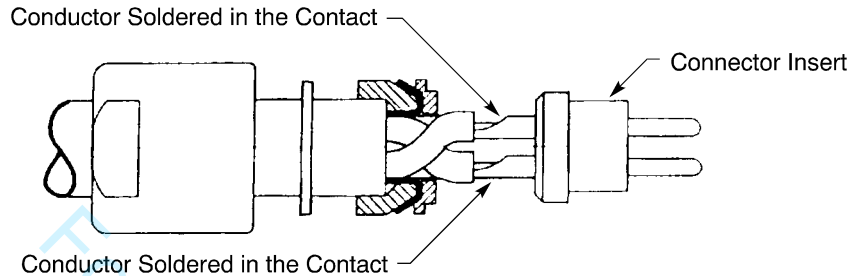

CONDUCTORS SOLDERED IN THE CONTACTS
Figure 10

- (1) Examine the rear end of the connector insert.

Make sure that there is not any of these types of damage:

- Gouges or cracks between two contact cavities
- Gouges or cracks from a contact cavity to the edge of the connector insert.

- (2) Solder each conductor in the solder cup of the applicable contact. Refer to Subject 20-40-00 and Figure 10.


Make sure that:

- There are no bad solder joints
- There are no broken strands of the conductor at the solder joint
- There is no damage to the strands of the conductor that shows the base metal.

C. Connector Assembly

- (1) Put the bushing that has the slot on the connector insert.

Make sure that the bushing is on the solder cups of the contacts and the conductors. Refer to Figure 11.

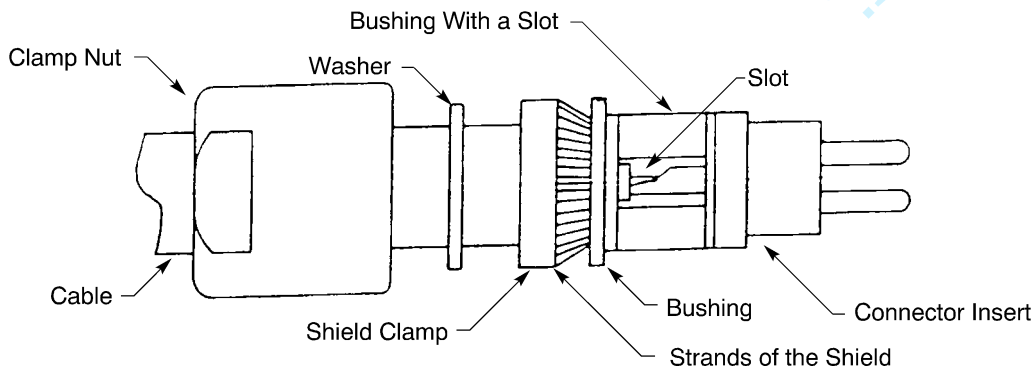


POSITION OF THE BUSHING WITH A SLOT
Figure 11

20-40-15

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE ITT GREMAR 150900-() TWINAXPLUG CONNECTOR

- (2) Push the connector insert into the connector shell until it stops.
- (3) Engage the threads of the clamp nut and the connector shell.
Make sure that there is no damage to the threads of the nut or the shell.
- (4) Tighten the nut until it stops. Refer to Figure 12.

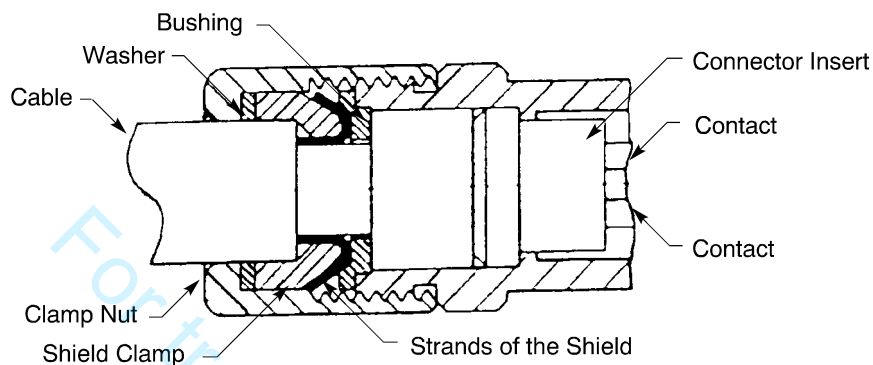

ASSEMBLED PLUG CONNECTOR

Figure 12

4. CONNECTOR INSTALLATION

A. Installation of a Plug into a Receptacle

- (1) Examine the front face.
Make sure that there is not an of these types of damage:
 - A bent contact pin
 - A crack or a chip from one contact cavity to another contact cavity
 - A crack or a chip from a contact cavity to the edge of the connector insert.
- (2) Align the plug with the receptacle.
Make sure that:
 - The contacts in the plug are aligned with the contacts in the receptacle
 - The longitudinal axis of the plug is parallel to the longitudinal axis of the receptacle.
- (3) Push the plug into the receptacle.
Make sure that the contacts are fully engaged.
- (4) Engage the threads of the coupling nut and the threads of the receptacle shell.
- (5) Tighten the nut until it stops.



707, 727-787

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE W. W. FISHER D105A067-60 CONNECTOR

<u>Paragraph</u>	<u>Page</u>
1. <u>PART NUMBERS AND DESCRIPTION</u>	1
A. Necessary Parts for Assembly	1
2. <u>CONNECTOR ASSEMBLY</u>	1
A. Dust Cover Installation	1
B. Connector Assembly	2
C. Wire Installation	2
D. Backshell Installation	3

For training purposes only!

20-40-16 CONTENTS

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE W. W. FISHER D105A067-60 CONNECTOR

1. PART NUMBERS AND DESCRIPTION


A. Necessary Parts for Assembly

Table 1
ASSEMBLY PART NUMBERS

Part Number	Description	Supplier
437-027	Backshell	Glenair
667-047	Dust Cover	Glenair
D105A067-60	Connector	W. W. Fisher

2. CONNECTOR ASSEMBLY


A. Dust Cover Installation

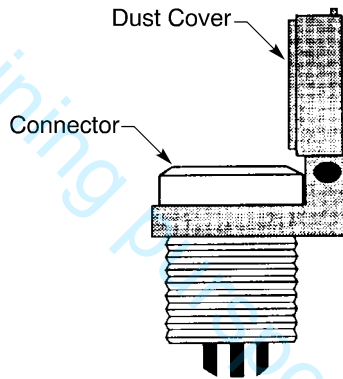

POSITION OF THE DUST COVER ON THE CONNECTOR
Figure 1

Refer to Figure 1.

- (1) Install the dust cover over the rear of the connector.
- (2) Open the dust cover so that it is against the front end of the connector.

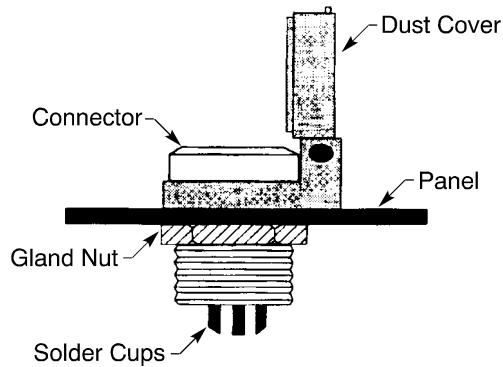STANDARD WIRING PRACTICES MANUAL
ASSEMBLY OF THE W. W. FISHER D105A067-60 CONNECTOR
B. Connector Assembly

POSITION OF THE CONNECTOR ON THE PANEL
Figure 2

Refer to Figure 2.

- (1) Put the connector into the correct panel cutout.
- (2) Engage the threads of the gland nut the rear of the connector body.
- (3) Torque the gland nut 50 inch-pounds \pm 5 inch-pounds.
- (4) Close the dust cover.


C. Wire Installation

- (1) Remove a 0.25 inch \pm 0.1 inch length of insulation from the end of each wire. Refer to Subject 20-00-15.
- (2) Find the correct solder cup for each wire. Refer to the Wiring Diagram Manual.
- (3) Put each wire through the applicable hole in the insulator of the backshell.
- (4) Push each wire into the correct solder cup.
Make sure the distance from the end of the wire insulation to the end of the solder cup is less than 0.03 inch.
- (5) Solder each wire in the applicable solder cup.

STANDARD WIRING PRACTICES MANUAL

ASSEMBLY OF THE W. W. FISHER D105A067-60 CONNECTOR

D. Backshell Installation

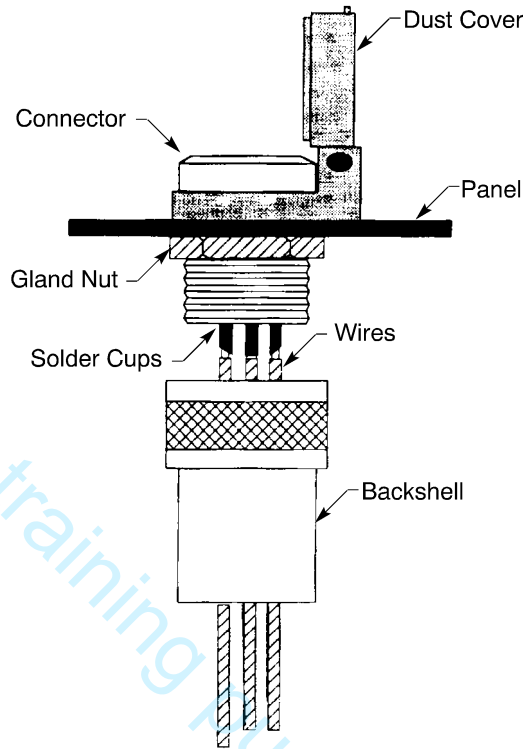

INSTALLATION OF THE BACKSHELL

Figure 3

- (1) Align the holes in the insulator with the solder cups.
Refer to Figure 3.
- (2) Push the backshell until it is against the body of the connector.
- (3) Engage the threads of the coupling ring and the body of the connector.
- (4) Torque the backshell 50 inch-pounds \pm 5 inch-pounds.